



MAGNETVENTILER

K52W1018/14 Tillbehör

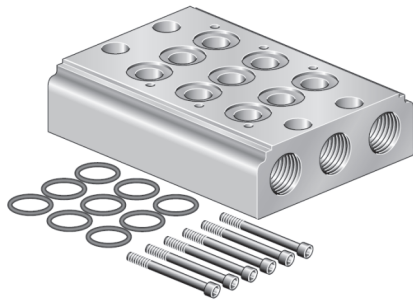


KME Basplatta

Basplatta för blockmontage av 2-16st K52W1018/14.
Skruvvar och tätningar medföljer.

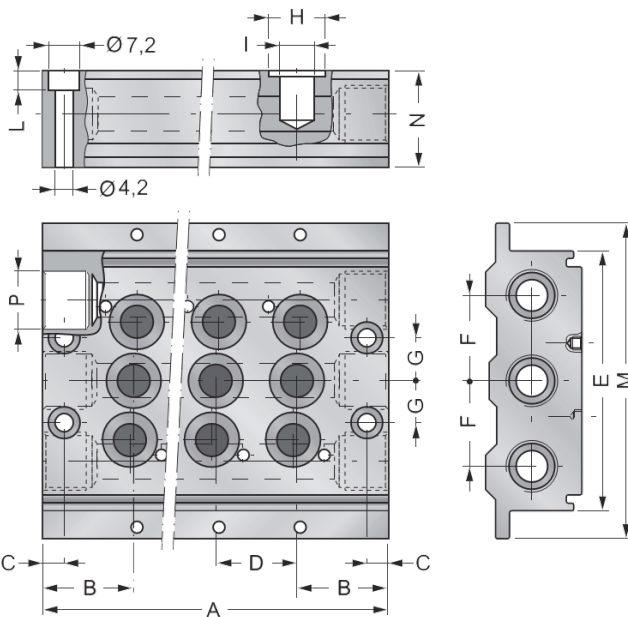

Tillbehör

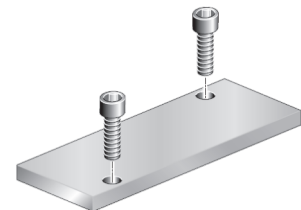

Blindplatta KPCH018/14

Dimensioner

Benämning	Antal platser	A	B	C	D	E	F	G	ØH	ØI	L	M	N	P
KME218	2	61	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME318	3	80	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME418	4	99	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME518	5	118	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME618	6	137	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME718	7	156	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME818	8	175	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME918	9	194	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME1018	10	213	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME1218	12	251	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME1418	14	289	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME1618	16	327	21	5	19	60	19	10	13	8	4,5	74,5	26	G1/4
KME214	2	73	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME314	3	96	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME414	4	119	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME514	5	142	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME614	6	165	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME714	7	188	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME814	8	211	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME914	9	234	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME1014	10	257	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME1214	12	303	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME1414	14	349	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8
KME1614	16	395	25	6,5	23	70	23	11,5	15,9	10	5	85	26	G3/8